

Full-scale load test of a PRC bridge beam after 60 years of service life

Original

Full-scale load test of a PRC bridge beam after 60 years of service life / Gino, Diego; Miceli, Elena; Giordano, Luca; Castaldo, Paolo; Mancini, Giuseppe; De Iuliis, Massimiliano; Mori, Michele; Deiana, Maurizio; Magri, Bernardo. - In: *PROCEDIA STRUCTURAL INTEGRITY*. - ISSN 2452-3216. - ELETTRONICO. - 64:(2024), pp. 456-463. (7th International Conference on Smart Monitoring, Assessment and Rehabilitation of Civil Structures, SMAR 2024 Salerno (Italy) 4-6 September 2024) [10.1016/j.prostr.2024.09.285].

Availability:

This version is available at: 11583/3002412 since: 2025-08-14T08:04:13Z

Publisher:

Elsevier

Published

DOI:10.1016/j.prostr.2024.09.285

Terms of use:

This article is made available under terms and conditions as specified in the corresponding bibliographic description in the repository

Publisher copyright

(Article begins on next page)



SMAR 2024 – 7th International Conference on Smart Monitoring, Assessment and Rehabilitation of Civil Structures

Full-scale load test of a PRC bridge beam after 60 years of service life

Diego Gino^a, Elena Miceli^{a*}, Luca Giordano^a, Paolo Castaldo^a, Giuseppe Mancini^a,
Massimiliano De Iuliis^a, Michele Mori^b, Maurizio Deiana^c, Bernardo Magrì^c

^aPolitecnico di Torino, Corso Duca degli Abruzzi 24, Turin 10129, Italy

^bSINA S.p.A, Viale Isonzo, 14/1, Milan 20135, Italy

^cAutostrada dei fiori S.p.A, Via della Repubblica 46, Imperia 18100, Italy

Abstract

The safety assessment of existing infrastructure is a matter of significant concern for infrastructure management authorities. Specifically, in Italy, numerous reinforced concrete (RC) and prestressed concrete (PRC) bridges were constructed during the 1960s and 1970s. Many of these bridges are still in operation, raising questions about their current load-bearing capacity given the long service time. This study focuses on the experimental examination of the ultimate performance of a PRC bridge beam taken from a bridge deck constructed in the 1960s. The bridge, known as the Mollere viaduct, was situated near the town of Ceva (Italy), along the Torino-Savona highway A6. The PRC beam was characterized by a simple supported static scheme with semi-articulated end connections having a total span of 34.60 meters. The beam had been prestressed using post-tensioning techniques. This paper presents an overview of the critical aspects related to the planning of the experimental campaign and, in conclusion, highlights the preliminary findings with respect to structural safety and monitoring.

© 2024 The Authors. Published by ELSEVIER B.V.

This is an open access article under the CC BY-NC-ND license (<https://creativecommons.org/licenses/by-nc-nd/4.0>)

Peer-review under responsibility of SMAR 2024 Organizers

Keywords: Full-scale; ultimate behavior; prestressing; existing bridge.

* Corresponding author. Tel.: +011-0905307.

E-mail address: elena.miceli@polito.it

1. Introduction

In the field of large-scale infrastructure management, the focus on ensuring the structural integrity of existing bridges is paramount (Bertagnoli et al. (2024), Troisi and Arena (2022), Troisi and Alfano (2023), Troisi and Alfano (2021), Medina et al. (2022)). Engineering firms specializing in this domain are entrusted with devising strategies to mitigate potential risks associated with future adverse events involving bridges and related infrastructures (Santarsiero et al. (2021), Miluccio et al. (2021)). Moreover, their efforts contribute to the formulation of plans and regulations by national authorities, aimed at minimizing risks (Linee guida per la classificazione e gestione del rischio, la valutazione della sicurezza ed il monitoraggio dei ponti esistenti (2021), DM 17/12/2020 n. 578 (2020)). A central challenge concerning many existing bridges is their proximity to or reaching of their design working life. This underscores the necessity of assessing their safety status and actively monitoring factors such as vehicular overloads and environmental degradation (Gino et al. (2019), Natali et al. (2023), Miceli and Castaldo (2023)) including also detailed evaluation of the related structural behaviour (Ferrara et al. (2024), Gino et al. (2024)). Recent research has delved into understanding how bridge systems respond to seismic activity through small-scale experimental tests conducted using a shaking table Shoushtari et al. (2021). Similarly, experiments on prestressed reinforced concrete (PRC) beams have been undertaken by Botte et al. (2021), although not directly related to bridge systems. Experiments has been also proposed on RC bridges beams but without prestressing technology as presented by Darò et al. (2023). These experiments, while insightful, do not fully replicate the authentic behavior of bridge beams constituted by PRC members under traffic loads.

This study presents preliminary findings from a full-scale experimental investigation conducted on a PRC beam spanning 34.60 meters. The beam, post-tensioned over 60 years ago, was originally part of the Mollere viaduct along the Torino-Savona highway in Italy (Darò et al. (2023)) but was intentionally removed during dismantling work. It was subsequently relocated and supported by two separate RC footing foundations within an appropriately prepared testing area. The load test involved applying prescribed displacements at two central supports located 5.02 meters apart across the midspan, using hydraulic jacks with a maximum capacity of 2000 kN (200 tons) each. The PRC beam was tested up to a maximum deflection displacement of approximately 50 cm without experiencing catastrophic failure but exhibiting a progressive bending failure mode with significant ductility. This paper further discusses the test setup configuration and preliminary outcomes.

2. Overview of the considered PRC beam

This section presents a thorough examination of the PRC beam, encompassing its geometric features, material attributes derived from initial design records, and its present state, inclusive of damage identification. Positioned as the pivotal element within a girder bridge deck constituted by six primary beams, the beam measures an overall height of 190 cm and displays a symmetrical cross-sectional configuration, as illustrated in Figure 1(c) based on available documentation and on-site surveys.

The cross-sectional setup entails an in-situ cast concrete slab with a thickness of 20 cm and a prefabricated main PRC beam in precast concrete. Despite the longitudinal separation from the original deck, remnants of the in-situ cast concrete crossbeams endure at the supports and midspan. Complemented by bonded prestressing main reinforcement facilitated through post-tensioning with injected mortar, the beam features nine tendons, each comprising 18 wires with a 7 mm diameter, following a parabolic trajectory, as depicted in Figures 1(a)-(d). The arrangement of parabolic tendons is delineated in Figure 1(d), while Figure 1(a) illustrates the longitudinal profile of the PRC beam. Figure 2 portrays the assessment of the structural member's degradation level through preliminary inspections, revealing a corrosive process in the web stirrups and reinforcements near the drainage device holes in the deck. Additionally, longitudinal cracks along the alignment of the post-tensioning tendons near the anchorage heads, ascribed to the "bursting" phenomenon, were noted, potentially present even during post-tensioning. Remarkably, despite 60 years of service, no significant degradation was discerned. Information pertaining to the condition of the prestressing tendons, including the quality of the original mortar injection within the sheaths, remained elusive prior to testing.

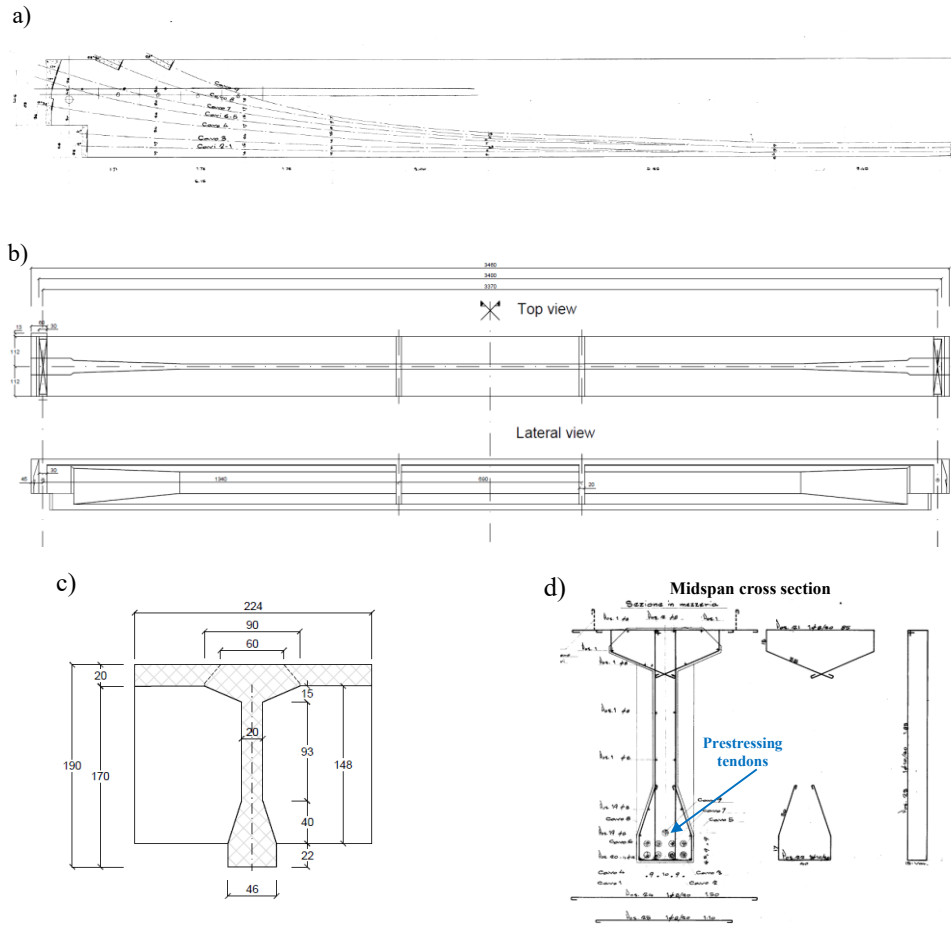


Fig. 1. Arrangement of the prestressing tendons longitudinally in (a). The longitudinal configuration of the beam is illustrated in (b). At the midspan, a cross-sectional perspective of the precast concrete beam and the top slab is depicted in (c), shows the reinforcement layout and placement of the prestressing tendons in (d). All measurements are presented in centimeters.

Mechanical properties for concrete, sourced from initial design reports, include $R_{ck}=25\text{MPa}$ for cast in-situ and $R_{ck}=35\text{MPa}$ for precast concretes. Furthermore, ordinary reinforcements are represented by Feb44k with $f_{yk}=440\text{MPa}$. In formulating the experimental test to estimate its ultimate capacity, consideration was given to the prestressing reinforcement steel, characterized by $f_{p(0.1)k}=1558\text{MPa}$ and a declared tensioning stress level of 1150MPa .

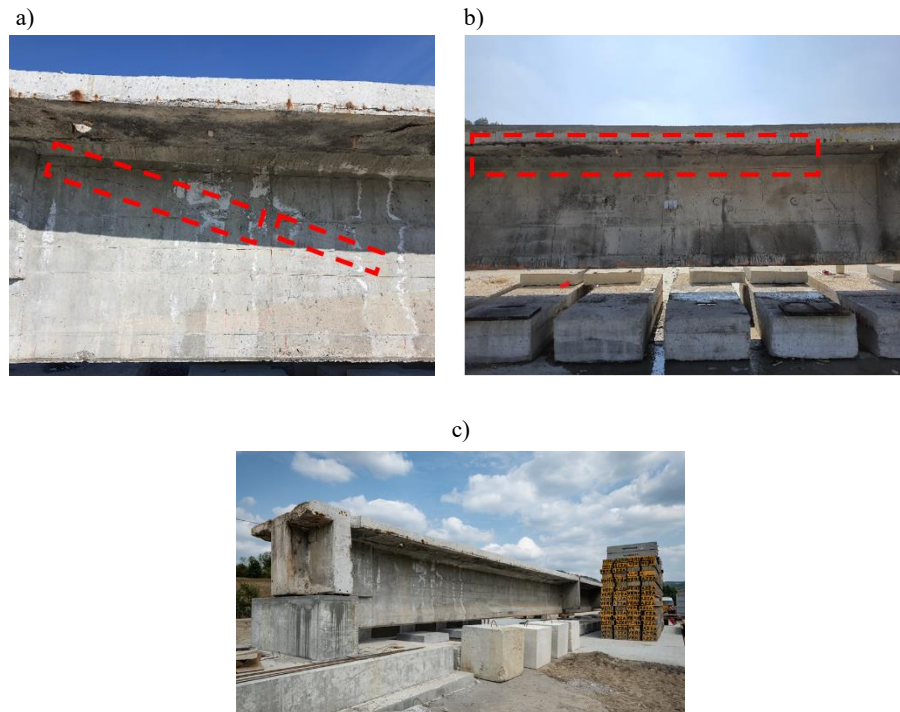


Fig. 2. Cracking along the longitudinal direction near the path of post-tensioning tendons close to the anchorages. (a). Longitudinal cracking of the slab (b). General view of the beam (c).

3. Planning of the experimental test

Detailing the test setup configuration, loading procedure, and monitoring is the focus of this section.

3.1. Testing procedures

The positioning of the PRC beam within the test area adheres to the arrangement depicted in Figure 3 (a)-(b). Supported by two specifically casted in situ RC footings labeled as support A and B, the beam is situated accordingly. Underneath the beam, an RC slab footing measuring 20x22x0.5m has been erected to offer a clean and stable surface for accommodating the loading devices, totaling 3000 kN in weight, as illustrated in Figure 3 (b). Strategically placed concrete blocks beneath the span ensure a clearance of 50 cm, corresponding to the maximum midspan displacements achievable during the test, as shown in Figure 3 (a). Positioned 5.02m apart across the midspan, two jacks (A and B) are situated on the top slab, positioned as close as feasible to the original transverse beams. Each jack has a capacity of 2000 kN (equivalent to 200 tons). Figure 3 (b) offers a visual depiction of the test setup, showing the counteracting structure constructed using Azobè wood walls, steel beams, and iron ballasts. The mobilization of heavy materials within the testing area was facilitated by a mobile crane.

The load test entailed applying controlled displacements at two jacks, A and B, as depicted in Figure 4. Using geometric and mechanical data acquired from a historical survey and visual inspection of the RC beam spanning 34.60 meters, a resisting bending moment of 17750 kNm was computed following EN 1992-1-1 guidelines. It's essential to emphasize that this resisting moment value was determined utilizing mean values of material mechanical properties derived from known characteristic values (from design reports), per EN 1992-1-1.

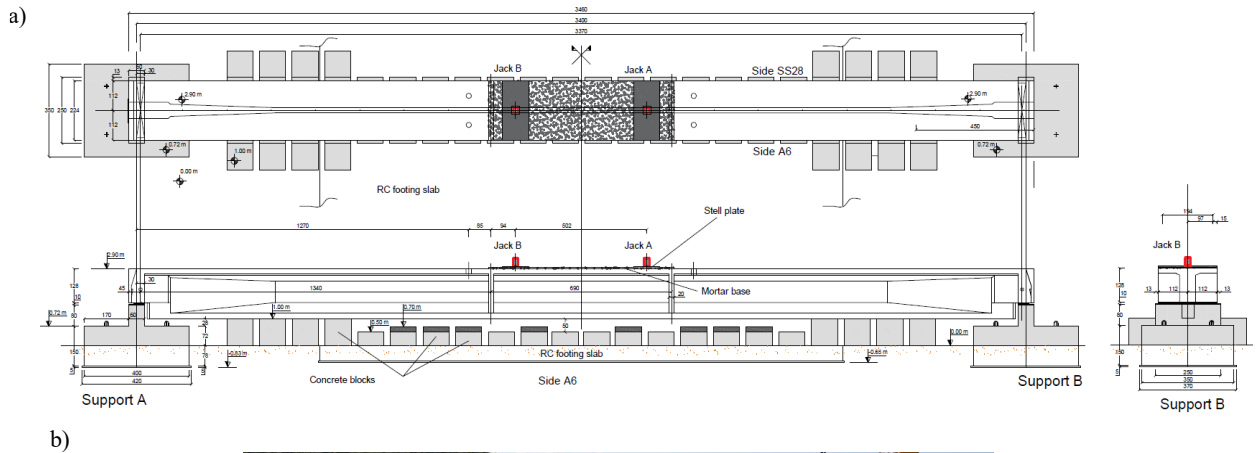


Fig.3. The testing layout is depicted in (a), with measurements in centimeters. (b) provides a general view of the testing area.

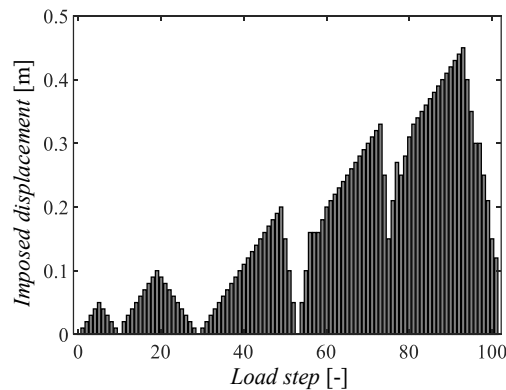


Fig.4. The imposed displacement at jacks A and B during the execution of the test is illustrated.

To achieve the estimated resisting moment, the total counterweight on the counteracting steel structure (depicted in Figure 3(b)), comprising the iron ballasts and the structure's self-weight, amounted to 3000 kN (300 tons). This configuration ensured that each of the two load points could apply a maximum force of 1500 kN (150 tons) to the beam, maintaining a sufficient margin for conducting the test. The jack displacements were incrementally increased at a slow pace between each step, with the reacting force measured and recorded upon reaching the desired displacement level.

a)



b)

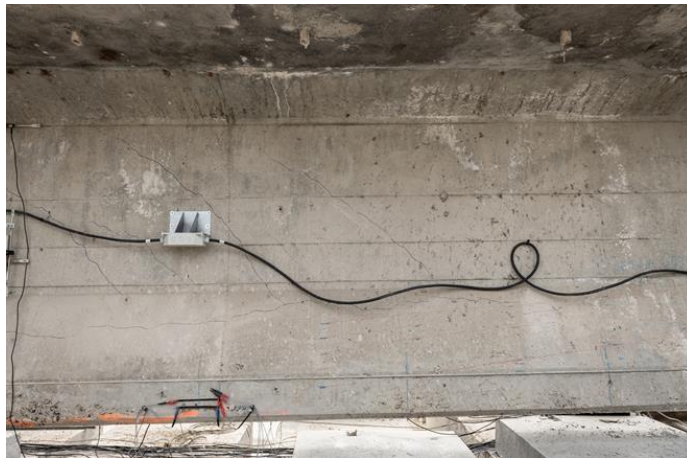


Fig. 6. (b) provides a view of the deflection of the PRC beam under the maximum load. (c) shows the crack pattern of shear cracks close to the support.

The test concluded upon the beam exhibiting a mid-span deflection of approximately 46 cm, corresponding to a total load transmitted by the jacks of around 1800 kN. Across the beam axis, the neutral axis consistently extended beyond the upper slab thickness in every investigated section, leading to continuous compression of the slab. The observed crack pattern (Figure 6(b)) aligns with that of a structure fixed at both ends with simple supports and loaded by two concentrated forces straddling the midpoint. In the central zone with a constant moment (between the two jacks), cracks appeared nearly vertical due to minimal interference between bending and shear stress. However, as one moves toward the supports where shear stress intensifies, cracks tend to incline, with a minimum angle of around 30 degrees, influenced partially by the presence of prestressing force. The maximum midspan deflection measured approximately higher than 45 cm, as evident in Figure 6(a). Upon reaching this displacement level, the test was concluded.

5. Conclusions

This study serves as an initial step in evaluating the structural integrity of existing bridges, with a primary focus on enhancing safety and averting collapses. It delves into key considerations for planning an on-site, full-scale experimental test involving the loading of a 34.60-meter-long simply supported beam. By examining the response of prestressed reinforced concrete beams after more than 60 years of service, the study sheds light on limited observable degradation phenomena. Visual inspections indicate an overall state of healthiness, with preliminary test results

reinforcing these observations. The beam demonstrates a typical bending failure mode, with a maximum load of around 1800 kN applied by the jack, resulting in a maximum mid-span displacement higher than 45 cm. This underscores a notably ductile response, confirming the beam's satisfactory condition based on initial visual inspections. Ongoing comprehensive investigations will encompass comparing various monitoring approaches and conducting numerical simulations to gain a thorough understanding of the structural response. The outcomes of this research hold significant potential in guiding future interventions and maintenance strategies for outdated bridge decks within major infrastructures.

Acknowledgements

This study was carried out within the Ministerial Decree no. 1062/2021 and received fund-ing from the FSE REACT-EU - PON Ricerca e Innovazione 2014-2020. This manuscript reflects only the authors' views and opinions, neither the Eu-ropean Union nor the European Commission can be considered responsible for them.

This work is part of the collaboration “Safety assessment of Structures and Infrastructures - Valutazione della sicurezza di strutture e infrastrutture in cemento armato” with SINA S.p.A. and Autostrada dei Fiori S.p.a..

This work is part of the research activities performed within “RELUIS-BRIDGE”.

This work is also part of the research activities performed within PRIN 2023-2025 “Data fusion based digital twins for structural safety assessment”.

This work is also part of the research activities performed within PRIN 2017 “Life-long optimized structural assessment and proactive maintenance with pervasive sensing techniques”.

References

- Bertagnoli, G., Ferrara, M., Miceli, E., Castaldo, P., Giordano, L. 2024. Safety assessment of an existing bridge deck subject to different damage scenarios through the global safety format ECOV. *Engineering Structures* 306:117859.
- Botte, W., Vereecken, E., Taerwe, L., Caspeele, R., 2021. Assessment of posttensioned concrete beams from the 1940s: Large-scale load testing, numerical analysis and Bayesian assessment of prestressing losses. *Structural Concrete*. DOI: 10.1002/suco.202000774
- CEN. EN 1992-1-1. Eurocode 2: Design of concrete structures – Part 1-1: General rules and rules for buildings. Brussels, Belgium: Comit'ee Europ'een de Normalisation; 2004.
- Darò, P., La Mazza, D., Tetta, E., Lastrico, G., Alovisi, I., Mancini, G., Miceli, E., Gino, D., Amendola, G., Giordano, L., Castaldo, P., Mariscotti, M., Garozzo, M., Deiana, M., Magri, B., 2023. Full-Scale Experimental Testing on a Reinforced Bridge RC Beam: Experimental and SHM Results. *Lecture Notes in Civil Engineering*, 349:1827–1836.
- Ferrara, M., Gino, D., Miceli, E., Giordano, L., Malavisi, M., Bertagnoli, G., 2024. Safety assessment of existing prestressed RC bridge decks through different approaches. *Structural Concrete*. DOI: 10.1002/suco.202301049
- Gino, D., Castaldo, P., Bertagnoli, G., Giordano, L., Mancini, G., 2019. Partial factor methods for existing structures according to fib Bulletin 80: Assessment of an existing prestressed concrete bridge. *Structural Concrete*. DOI: 10.1002/suco.201900231
- Gino, D., Miceli, E., Castaldo, P., Recupero, A., Mancini, G., 2024. Strain-based method for assessment of global resistance safety factors for NLNAs of reinforced concrete structures. *Engineering Structures*, 304:117625. DOI: 10.1016/j.engstruct.2024.117625
- Medina, P.A., González, F.J.L., Todisco, L., 2022. Data-driven prediction of long-term deterioration of RC bridges. *Construction and Building Materials*, 317:125790. DOI: 10.1016/j.conbuildmat.2021.125790
- Miceli, E., Castaldo, P., 2023. Robustness Improvements for 2D Reinforced Concrete Moment Resisting Frames: Parametric Study by Means of NLFE Analyses. *Structural concrete*, <https://doi.org/10.1002/suco.202300443>
- Miluccio, G., Losanno, D., Parisi, F., Cosenza, E., 2021. Traffic-load fragility models for prestressed concrete girder decks of existing Italian highway bridges. *Engineering Structures*, 249:113367.
- Natali, A., Cosentino, A., Morelli, F., Salvatore, W., 2023. Multilevel Approach for Management of Existing Bridges: Critical Analysis and Application of the Italian Guidelines with the New Operating Instructions. *Infrastructures*, 8:70. DOI: 10.3390/infrastructures8040070
- Santarsiero, G., Masi, A., Picciano, V., Digrisolo, A., 2021. The Italian Guidelines on Risk Classification and Management of Bridges: Applications and Remarks on Large Scale Risk Assessments. *Infrastructures*, 6:111. DOI: 10.3390/infrastructures6080111
- Shoushtari, E., Saidi, S.M., Itani, A., Mohamed, M., 2021. Seismic performance of a two-span steel girder bridge with ABC connections. *Engineering Structures*, 241.
- Troisi, R., Alfano, G., 2021. Firms' crimes and land use in Italy: An exploratory data analysis. *Smart Innovation, Systems and Technologies* 178:749–758.
- Troisi, R., Alfano, G., 2023. Proximity and inter-firm corruption: A transaction cost approach. *Small Business Economics* 60(3):1105–1120.
- Troisi, R., Arena, L., 2022. Organizational Aspects of Sustainable Infrastructure Safety Planning by Means of Alert Maps. *Sustainability (Switzerland)* 14(4):2335.